



Firmware Version: 1.10rc064

Published Date: 2014/12/16

Content:

Upgrading Instructions:..... 2
 Upgrading by using Web-UI..... 2
New Features:..... 2
Changes of MIB & D-View Module:..... 2
Problems Fixed: 2
Known Issues: 3
Related Documentation: 3

Revision History and System Requirement:


Firmware Version	Date	Model	Hardware Version
1.10rc064	2014/12/16	DAP-3690	A1

Upgrading Instructions:

D-Link AP supports firmware upgrading via Web-UI. You may download the firmware from D-Link web site <http://tsd.dlink.com.tw>.

Upgrading by using Web-UI

1. Connect a work station to the LAN port of Access Point.
2. Open the web browser of work station and entering the IP address of the AP. The system default IP address is 192.168.0.50.
3. Enter administrator's username and password, user name is "admin" and leave the password field blank by default.
To update the AP's firmware, click **Maintenance > Firmware and SSL Certification Upload**

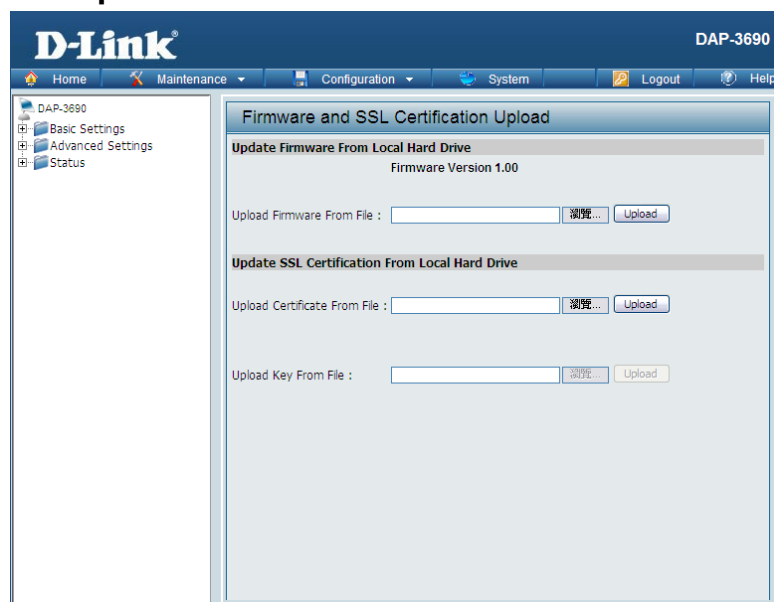

New Features:

Support APM2 v3.0.

Changes of MIB & D-View Module:

None

Problems Fixed:

Firmware Version	Problems Fixed
V1.10rc064	<ol style="list-style-type: none"> 1. Resolved date and time manually configure problem 2. Enhance interface index table for MIB

	<ol style="list-style-type: none"> 3. Enhance broadcast forwarding 4. Enhance 2.4GHz/5GHz wireless stability 5. Resolved 5GHz MSSID issue 6. Support LLDP 7. Enhance SSH for security issue 8. Support latest CE certification EN300 328/EN301 893 9. Support APM2 v3.0
--	--

Known Issues:

Firmware Version	Known Issues
V1.10rc064	None

Related Documentation:

None